
2019 DRINKING WATER QUALITY REPORT

PUBLIC WATER SYSTEM I.D. CO0121150

This required report is prepared in accordance with federal and state regulations of the Safe Drinking Water Act.

Esta información acerca de su agua potable es importante. Si usted no puede leer esto en inglés, por favor pídale a alquien que le traduzca esta importante información o llame a Cuidado al Cliente al número 719-448-4800.



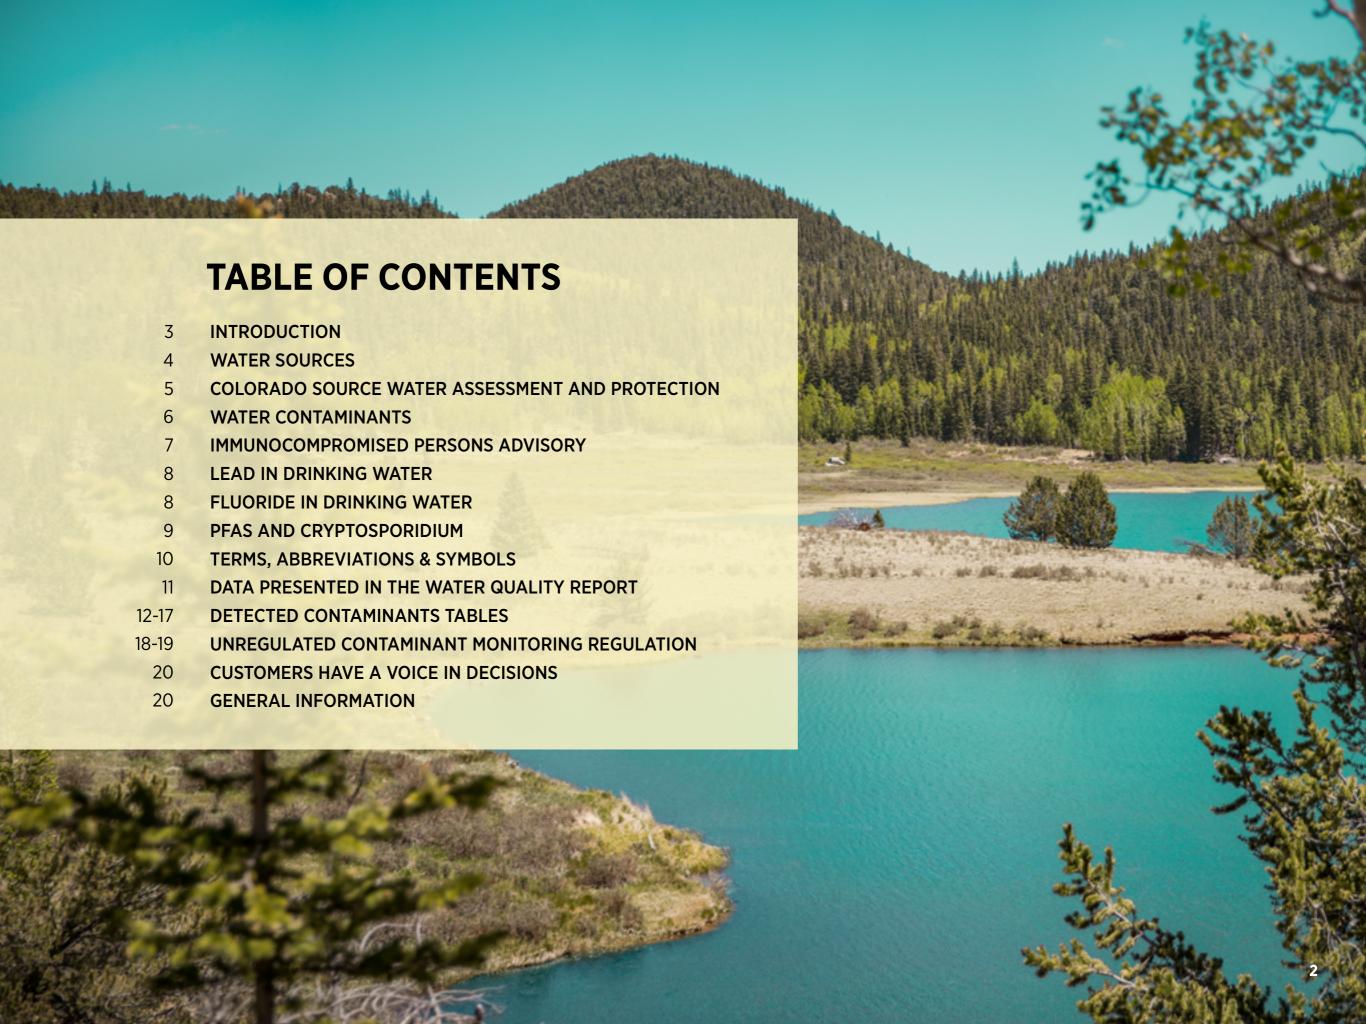



Colorado Springs Utilities proudly serves high quality water to nearly half a million customers every year. Although our source water comes straight from high mountain snowmelt, it takes the hard work and dedication of our employees to ensure that safe and reliable water is provided to you.

Every year, thousands of samples are collected at reservoirs and streams, at water treatment facilities and throughout the distribution system. Those samples are analyzed for numerous water quality parameters to ensure that safe and reliable water is served to our customers. These analyses are not only performed to meet regulatory requirements, but also for research and operational improvements.

We are pleased to share with you the 2019 Water Quality Report. The report is designed to provide you detailed information about your drinking water. If you have any questions about this report or the quality of your water, please do not hesitate to contact us at 719-668-4560.



WATER SOURCES

Your water is blended from multiple sources, including surface water and purchased water. Your water source may vary throughout the year.

MOUNTAIN WATER SOURCES

With no major water source nearby, much of our raw water collection system originates from nearly 200 miles away, near Aspen, Leadville, and Breckenridge. Almost 75 percent of our water originates from mountain streams. Water from these streams is collected and stored in numerous reservoirs along the Continental Divide. Collection systems in this area consist of the Homestake, Fryingpan-Arkansas, Twin Lakes, and Blue River systems.

The majority of this raw water is delivered to our city through pipelines that help protect it from contamination, such as herbicides, pesticides, heavy metals and other chemicals. After the long journey, water is stored locally at Rampart Reservoir and the Catamount reservoirs on Pikes Peak.

LOCAL SURFACE SOURCES

To supplement the water received from the mountain sources, we divert water from local surface water collection systems including:

- North and South Slopes of Pikes Peak Catamount Reservoirs, Crystal Reservoir, South Slope Reservoirs and tributaries
- North and South Cheyenne Creeks
- Fountain Creek
- · Monument Creek Pikeview Reservoir
- Northfield Watershed Rampart and Northfield Reservoirs
- Pueblo Reservoir

LOCAL GROUND WATER SOURCES

We previously pumped water from wells drilled into two different aquifers. We have two wells on the Denver aquifer (500-700 feet deep) and two wells on the Arapahoe aquifer (900-1,000 feet deep). These wells were deactivated in July 2015.

PURCHASED WATER SOURCE

Fountain Valley Authority or FVA (PWSID#CO0121300) receives water from the Fryingpan-Arkansas Project – a system of pipes and tunnels that collects water in the Hunter-Fryingpan Wilderness Area near Aspen. Waters collected from this system are diverted to the Arkansas River, near Buena Vista, and then flow about 150 miles downstream to Pueblo Reservoir. From there, the water travels through a pipeline to a water treatment plant before being delivered to Colorado Springs.

WATER TREATMENT

All water sources are treated at one of our six treatment plants prior to entering our drinking water distribution system, an intricate system of tanks, pumps and pipes that ultimately deliver water to your home or business.

COLORADO SOURCE WATER ASSESSMENT AND PROTECTION

The Colorado Department of Public Health and Environment has provided us with a Source Water Assessment Report for our water supply. For general information or to obtain a copy of the report please visit https://www.colorado.gov/cdphe/ccr (located under "Guidance: Source Water Assessment Reports" and searchable using "121150, Colorado Springs Utilities"), or by contacting Laboratory Services at 719-668-4560.

The Source Water Assessment Report provides a screening-level evaluation of potential contamination that could occur. It does not mean that the contamination has occurred or will occur. We can use this information to evaluate the need to improve our current water treatment capabilities and prepare for future contamination threats. This can help us ensure that quality finished water is delivered to your homes. In addition, the source water assessment results provide a starting point for developing a source water protection plan.

Potential sources of contamination to our source water areas may come from:

- EPA Superfund Sites
- EPA Abandoned Contaminated Sites
- EPA Hazardous Waste Generators
- EPA Chemical Inventory/Storage Sites
- EPA Toxic Release Inventory Sites
- Permitted Wastewater Discharge Sites
- Aboveground, Underground and Leaking Storage Tank Sites

- Solid Waste Sites
- Existing/Abandoned Mine Sites
- Concentrated Animal Feeding Operations
- Other Facilities
- Commercial/Industrial Transportation
- · High- and Low-Intensity Residential
- Urban Recreational Grasses
- Quarries/Strip Mines/Gravel Pits

- Agricultural Land (row crops, small grain, pasture/hay, orchards/vineyards, fallow and other)
- Forest
- Septic Systems
- Oil/Gas Wells
- Road Miles

The results of the source water assessment are not a reflection of our treated water quality or the water you receive, but rather a rating of the susceptibility of source water contamination under the guidelines of the Colorado Source Water Assessment and Protection (SWAP) program.




WATER CONTAMINANTS

The sources of drinking water (both tap water and bottled water) include rivers, lakes, streams, ponds, reservoirs, springs and wells. As water travels over the surface of the land or through the ground, it dissolves naturally occurring minerals and, in some cases, radioactive material, and can pick up substances resulting from the presence of animals or from human activity.

Contaminants that may be present in source water include:

- Microbial contaminants, such as viruses and bacteria, which may come from sewage treatment plants, septic systems, agricultural livestock operation and wildlife.
- Inorganic contaminants, such as salts and metals, which can be naturally occurring or result from urban stormwater runoff, industrial or domestic wastewater discharges, oil and gas production, mining or farming.
- Pesticides and herbicides that may come from a variety of sources, such as agriculture, urban stormwater runoff and residential uses.
- Organic chemical contaminants, including synthetic and volatile organic chemicals, which are by-products of industrial processes and petroleum production, and also may come from gas stations, urban stormwater runoff, and septic systems.
- Radioactive contaminants that can be naturally occurring or be the result of oil and gas production and mining activities.

In order to ensure that tap water is safe to drink, the Colorado Department of Public Health and Environment prescribes regulations limiting the amount of certain contaminants in water provided by public water systems. The Food and Drug Administration regulations establish limits for contaminants in bottled water that must provide the same protection for public health.

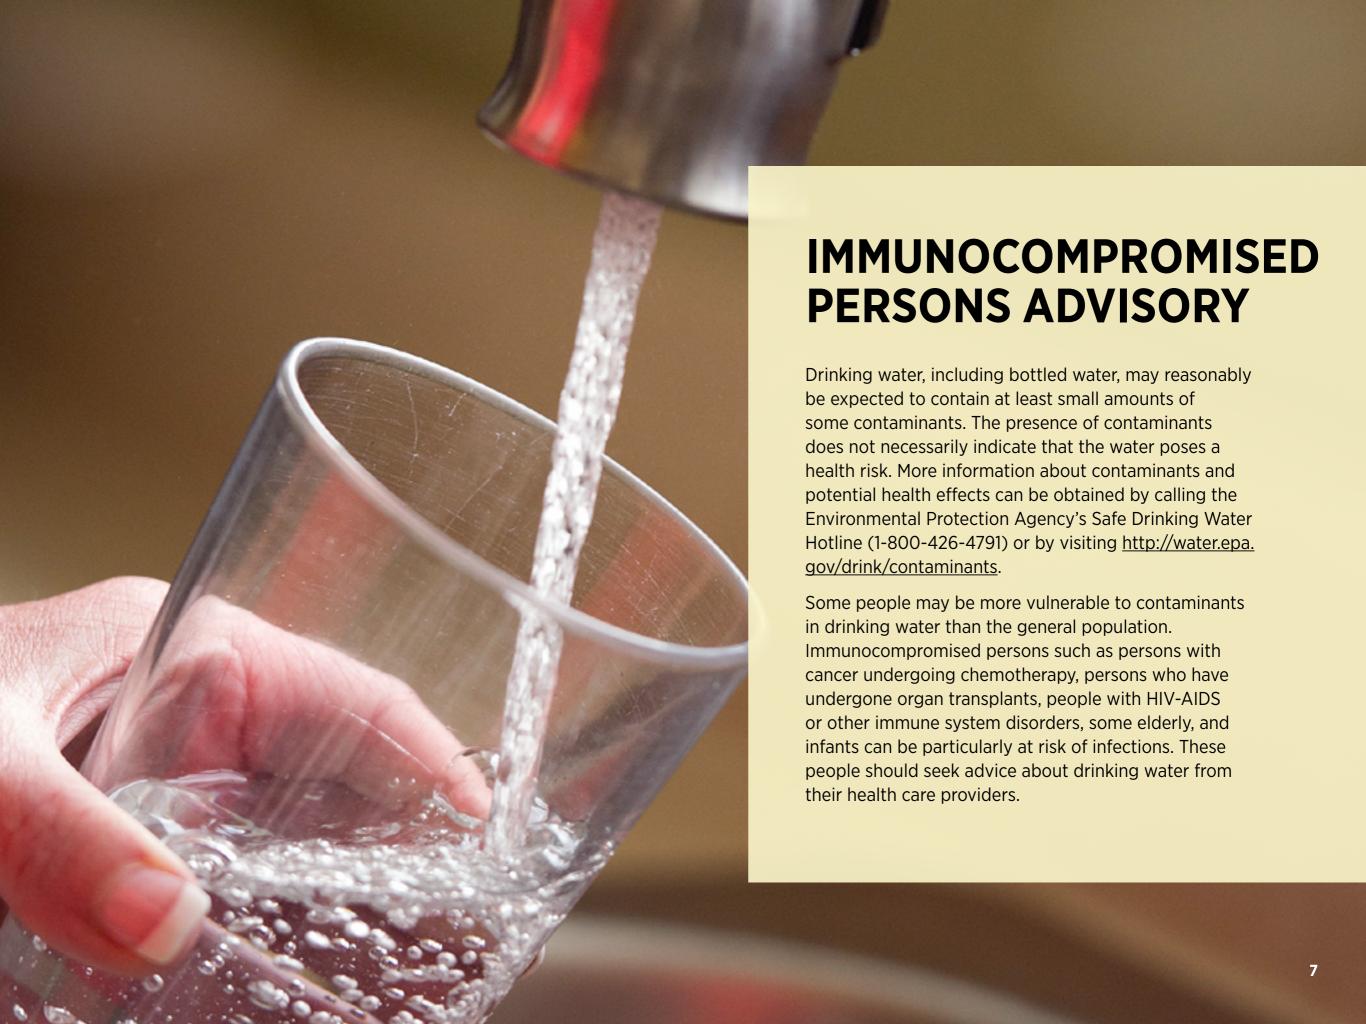





PER AND POLYFLUOROALKYL SUBSTANCES (PFAS)

PFAS are a group of man-made chemicals present in food packaging, commercial household products, drinking water sources and manufacturing facilities. Currently, PFAS are not regulated under the National Primary Drinking Water Regulations. However, the EPA did issue a health advisory for specific perfluorinated compounds (PFOA and PFOS) of 70 parts per trillion (ppt). Colorado Springs Utilities has not detected these compounds at our water treatment facilities above the method reporting limit of 10 ppt, including our most recent voluntary sampling conducted in the 1st quarter 2019. For more information about PFAS click https://www.epa.gov/pfas.

CRYPTOSPORIDIUM

Cryptosporidium is a microbial pathogen found in surface water throughout the United States. Although filtration removes cryptosporidium, the most commonly used filtration methods cannot guarantee 100 percent removal. No cryptosporidia were detected in our source water in 2018.


Ingestion of cryptosporidium may cause cryptosporidiosis, an abdominal infection. Symptoms of infection include nausea, diarrhea and abdominal cramps. Most healthy individuals can overcome the disease within a few weeks. However, immunocompromised people are at greater risk of developing the life-threatening illness. We encourage immunocompromised individuals to consult their doctor regarding appropriate precautions to take to avoid infection. Cryptosporidium must be ingested to cause disease, and it may be spread through means other than drinking water.

For more information about contaminants and potential health effects, or to receive a copy of the U.S. Environmental Protection Agency (EPA) and the U.S. Centers for Disease Control (CDC) guidelines on appropriate means to lessen the risk of infection by cryptosporidium and microbiological contaminants call the EPA Safe Drinking Water Hotline at 1-800-426-4791.

TERMS, ABBREVIATIONS & SYMBOLS

- MAXIMUM CONTAMINANT LEVEL (MCL) The highest level of a contaminant allowed in drinking water.
- TREATMENT TECHNIQUE (TT) A required process intended to reduce the level of a contaminant in drinking water.
- HEALTH-BASED A violation of either an MCL or TT.
- NON-HEALTH-BASED A violation that is not an MCL or TT.
- ACTION LEVEL (AL) The concentration of a contaminant which, if exceeded, triggers treatment and other regulatory requirements.
- MAXIMUM RESIDUAL DISINFECTANT LEVEL (MRDL) The highest level of a disinfectant allowed in drinking water. There is convincing evidence that addition of a disinfectant is necessary for control of microbial contaminants.
- MAXIMUM CONTAMINANT LEVEL GOAL (MCLG) The level of a contaminant in drinking water below which there is no known or expected risk to health. MCLGs allow for a margin of safety.
- MAXIMUM RESIDUAL DISINFECTANT LEVEL GOAL (MRDLG) The level of a drinking water disinfectant, below which there is no known or expected risk to health. MRDLGs do not reflect the benefits of the use of disinfectants to control microbial contaminants.
- VIOLATION (NO ABBREVIATION) Failure to meet a Colorado Primary Drinking Water Regulation.
- FORMAL ENFORCEMENT ACTION (NO ABBREVIATION) Escalated action taken by the State (due to the risk to public health, or number or severity of violations) to bring a non-compliant water system back into compliance.
- VARIANCE AND EXEMPTIONS (V/E) Department permission not to meet an MCL or treatment technique under certain conditions.

- GROSS ALPHA (NO ABBREVIATION) Gross alpha particle activity compliance value. It includes radium-226, but excludes radon-222, and uranium.
- PICOCURIES PER LITER (pCi/L) Measure of the radioactivity in water.
- NEPHELOMETRIC TURBIDITY UNIT (NTU) Measure of the clarity or cloudiness of water. Turbidity in excess of 5 NTU is just noticeable to the typical person.
- COMPLIANCE VALUE (NO ABBREVIATION) Single or calculated value used to determine if regulatory contaminant level (e.g., MCL) is met.
 Examples of calculated values are the 90th Percentile, Running Annual Average (RAA) and Locational Running Annual Average (LRAA).
- AVERAGE (X-BAR) Typical value.
- RANGE (R) Lowest value to the highest value.
- SAMPLE SIZE (N) Number or count of values (i.e., number of water samples collected).
- PARTS PER MILLION = MILLIGRAMS PER LITER (ppm = mg/L) As a reference, one part per million is the equivalent of one minute in two years or a single penny in \$10,000.
- PARTS PER BILLION = MICROGRAMS PER LITER (ppb = ug/L) As a reference, one part per billion is the equivalent of one minute in 2,000 years or a single penny in \$10,000,000.
- NOT APPLICABLE (N/A) Does not apply or not available.
- LEVEL 1 ASSESSMENT A study of the water system to identify potential problems and determine (if possible) why total coliform bacteria have been found in our water system.
- LEVEL 2 ASSESSMENT A very detailed study of the water system to identify potential problems and determine (if possible) why an E. coli MCL violation has occurred and/or why total coliform bacteria have been found in our water system on multiple occasions.

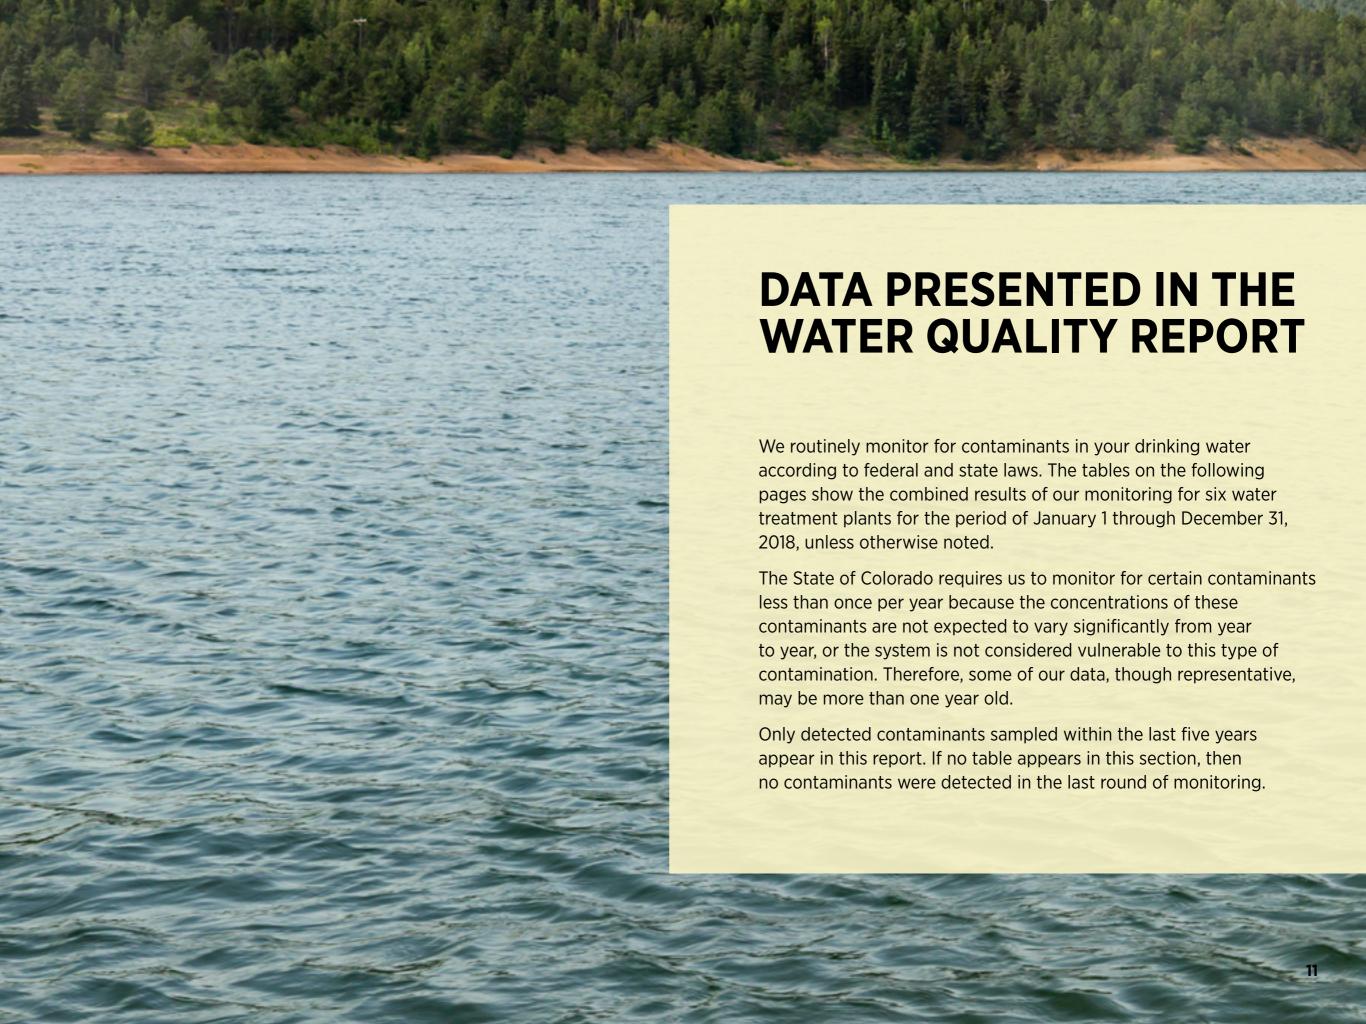

DETECTED CONTAMINANTS TABLES

COLORADO SPRINGS UTILITIES (PWSID CO0121150)

INORGANIC CONTAMINANTS

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	MCL	MCLG	UNITS	RANGE	AVERAGE	MCL VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Barium	2	2	ppm	0.01 - 0.06	0.03	No	Apr 2018	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits
Fluoride	4	4	ppm	0.16 - 0.53	0.41	No	Apr 2018	Erosion of natural deposits; discharge from fertilizer and aluminum factories
Nickel	N/A	N/A	ppb	0 - 0.003	0.001	No	Apr 2018	Erosion of natural deposits; discharge from industries; discharge from refineries and steel mills
Nitrate (as Nitrogen)	10	10	ppm	0 - 0.44	0.15	No	Apr 2018	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits
Selenium	50	50	ppb	0 - 0.006	0.002	No	Apr 2018	Discharge from petroleum and metal refineries; erosion of natural deposits; discharge from mines
Sodium	N/A	N/A	ppm	4.91 - 20.70	10.86	No	Apr 2018	Erosion of natural deposits

ORGANIC CONTAMINANTS

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	MCL	MCLG	UNITS	AVERAGE	RANGE DETECTED	MCL VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Di(2-ethylhexyl) phthalate	6	0	ppb	2.82	0 - 13	No	Jan, Apr, Jul, Aug, Oct	Discharge from rubber and chemical factories
Ethylbenzene	700	700	ppb	0.15	0 - 0.79	No	Jan, Jun, Jul, Oct	Discharge from petroleum refineries
Xylenes	10,000	10,000	ppb	1.82	0 - 7.9	No	Jan, Jun, Jul, Oct	Discharge from petroleum factories; discharge from chemical factories

RADIONUCLIDES

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	MCL	MCLG	UNITS	AVERAGE	RANGE LOW-HIGH	MCL VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Combined Radium	5	0	pCi/L	0.3	0.3 - 0.3	No	Jan 2017	Erosion of natural deposits
Combined Uranium	30	0	ppb	3.6	3.6 - 3.6	No	Jan 2017	Erosion of natural deposits

TURBIDITY

CONTINUOUSLY MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	TT REQUIREMENT	LEVEL DETECTED	TT VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Turbidity	Maximum 1 NTU for any single measurement	Highest single measurement: 0.366 NTU	No	2018	Soil runoff
Turbidity	In any month, at least 95% of samples must be less than 0.3 NTU	Lowest monthly percentage of samples meeting TT requirement: 99%	No	Sept	Soil runoff

DISINFECTANTS

CONTINUOUSLY MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	MRDL/TT REQUIREMENT	UNITS	LEVEL DETECTED	MRDL/TT VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Chlorine	TT = no more than 4 hours with a sample below 0.2 ppm	ppm	0 samples above or below the level	No	Jan - Dec 2018	Water additive used to control microbes

TOTAL ORGANIC CARBON (DISINFECTION BY-PRODUCTS PRECURSOR) REMOVAL RATIO AND FINISHED WATER

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	MCL	MCLG	UNITS	AVERAGE	RANGE LOW-HIGH	MCL VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Total Organic Carbon (TOC)	TT minimum ratio = 1.00	N/A	N/A	1.26	1 - 2.09	No	Monthly - Running Annual Average	Naturally present in the environment

DISINFECTION BY-PRODUCTS

MONITORED IN THE DISTRIBUTION SYSTEM

CONTAMINANT	MCL	MCLG	UNITS	AVERAGE	RANGE LOW-HIGH	MCL VIOLATION	HIGHEST COMPLIANCE VALUE	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Total Haloacetic Acids (HAA5)	60	N/A	dqq	33.42	10.2 - 55.0	No	53.6	Jan, Apr, Jul, Oct 2018	By-product of drinking water disinfection
Total Trihalomethanes (TTHM)	80	N/A	ppb	42.56	20.3 - 66.5	No	55.5	Jan, Apr, Jul, Oct 2018	By-product of drinking water disinfection

LONG TERM 2 ENHANCED SURFACE WATER TREATMENT RULE MONITORING

MONITORED RAW SOURCE WATER BEFORE IT ENTERS THE TREATMENT PLANT

CONTAMINANT	UNITS	RANGE DETECTED	MCL	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Cryptosporidium	oocysts	0	0	Jan - Apr 2018	Naturally occur in the environment
E. coli	MPN	0 - 2	N/A	Jan - Apr 2018	Naturally occur in the environment

DISINFECTANTS IN THE DISTRIBUTION SYSTEM

CONTAMINANT	MRDL/TT	LOWEST TT PERCENTAGE	NUMBER OF SAMPLES BELOW 0.2	UNITS	TT VIOLATION	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Chlorine	MRDL = 4 ppm TT = at least 95% of samples per month must be at least 0.2 ppm	99.11% Aug	2	ppm	No	2018	Drinking water disinfectant used to control microbes

LEAD AND COPPER

MONITORED IN THE DISTRIBUTION SYSTEM

CONTAMINANT	AL AT THE 90TH PERCENTILE	MCLG	UNITS	90TH PERCENTILE	SAMPLE SIZE	SAMPLE SITES ABOVE AL	AL EXCEEDANCE	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Copper	1.3	1.3	ppm	0.20	102	0	No	Mar - May 2018	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives
Lead	15	0	ppb	4.4	102	2	No	Mar - May 2018	Corrosion of household plumbing systems; erosion of natural deposits
Copper	1.3	1.3	ppm	0.13	100	0	No	Sept - Nov 2018	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives
Lead	15	0	ppb	3.6	100	0	No	Sept - Nov 2018	Corrosion of household plumbing systems; erosion of natural deposits

VIOLATIONS AND FORMAL ACTIONS

CONTAMINANT	CATEGORY	TIME PERIOD	HEALTH EFFECTS	COMPLIANCE VALUE	TT LEVEL OR MCL
Xylenes, Total ¹	Failure to monitor and/or report – non-health based	04/01/2018 - 06/30/2018	N/A	N/A	N/A
Ethylbenzene ¹	Failure to monitor and/or report – non-health based	04/01/2018 - 06/30/2018	N/A	N/A	N/A
Cross Connection Rule (Fountain Valley Authority) ²	Failure to meet Cross Connection/Backflow Requirements – health-based	11/14/18 - Open	May pose a risk to public health	N/A	N/A

Additional Violation Information

¹Colorado Springs Utilities is required to monitor its Ute Pass Water Treatment Plant on a quarterly basis for Total Xylenes and Ethylbenzene. In the 2nd quarter the sample for these parameters was sent to an outside laboratory for analysis, but the wrong parameters were analyzed. A subsequent re-sample was submitted in June, but it failed the external laboratory's quality control protocol. We were notified of this in July, which precluded an additional sampling since the 2nd quarter had ended. The required sampling and analysis for these parameters was conducted in the 3rd and 4th quarters of 2018.

² In March 2018, the Fountain Valley Authority (FVA) Water Treatment Plant identified 6 backflow prevention devices within its system that had not met the State's annual testing requirement in 2017. However, all of the devices were tested in March 2018 and passed the testing. Therefore, FVA is not aware of any uncontrolled cross connections in its system, and FVA provided the State with an updated Backflow Prevention and Cross-Connection Program Plan that includes measures to ensure the devices are tested annually.

CONTAMINANTS WITH SECONDARY MCL REQUIREMENTS¹

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	SMCL	UNITS	AVERAGE LEVEL DETECTED (RANGE)	SAMPLE DATES	POSSIBLE SOURCE(S) OF CONTAMINATION
Aluminum	0.050 - 0.2	ppm	0.037 (0 - 0.068)	Jan - Dec 2018	Erosion of natural deposits; water treatment chemical
Chloride	250	ppm	5.8 (1.4 - 10.8)	Jan - Dec 2018	Erosion of natural deposits
Manganese	0.5	ppm	0.0004 (0 - 0.0109)	Jan - Dec 2018	Erosion of natural deposits
Iron	0.3	ppm	0.003 (0 - 0.062)	Jan - Dec 2018	Erosion of natural deposits; leaching from plumbing materials
Sulfate	250	ppm	40 (12.3 - 125)	Jan - Dec 2018	Erosion of natural deposits
Zinc	5,000	ppb	0.2 (0 - 2.3)	Jan, Apr 2018	Leaching from plumbing materials

¹Secondary MCL (SMCL) is not enforceable but intended as guidelines. These contaminants in drinking water may affect the aesthetic qualities.

UNREGULATED CONTAMINANT MONITORING REGULATION (UCMR)

The 1996 amendments to the Safe Drinking Water Act required that EPA establish criteria for a program to monitor unregulated contaminants and to identify no more than 30 unregulated contaminants to be monitored every five years.

Unregulated contaminants are those contaminants that do not have a drinking water standard (maximum contaminant level) established by EPA. The purpose of the UCMR is to assist EPA in determining the occurrence of unregulated contaminants in drinking water and whether future regulation is warranted.

The fourth round of the UCMR required monitoring for 30 contaminants. We were required to monitor for these contaminants starting in January 2018. The results for any contaminants detected to date are listed below.

For further information on UCMR please visit https://www.epa.gov/dwucmr/fourth-unregulated-contaminant-monitoring-rule.

MONITORED AT THE TREATMENT PLANT (ENTRY POINT TO THE DISTRIBUTION SYSTEM)

CONTAMINANT	AVERAGE LEVEL DETECTED (RANGE)	RANGE	UNITS	SAMPLE DATES	POTENTIAL SOURCE(S) OF CONTAMINATION
Manganese	1.2	ND - 11	dqq	Jan, Apr, Jul, Oct 2018	Naturally occurring element; commercially available in combination with other elements and minerals; a by-product of zinc ore processing; used in infrared optics, fiber optic systems electronics and solar applications
1-Butanol	1.07	ND - 13	ppb	Jan, Mar, Apr, Jul, Oct 2018	Used as a solvent, food additive, and in the production of other chemicals

ND = Non-detect

MONITORED IN THE DISTRIBUTION SYSTEM

CONTAMINANT	AVERAGE LEVEL DETECTED (RANGE)	RANGE	UNITS	SAMPLE DATES	POTENTIAL SOURCE(S) OF CONTAMINATION
Haloacetic Acids 5 (HAA5)	33.9	10.2 - 55.0	dqq	Jan, Apr, Jul, Oct 2018	By-product of drinking water disinfection
Brominated Haloacetic Acids 6 (HAABr6)	3.18	0.79 - 9.10	ppb	Jan, Apr, Jul, Oct 2018	By-product of drinking water disinfection
Haloacetic Acids 9 (HAA9)	36.4	14.5 - 57.0	dqq	Jan, Apr, Jul, Oct 2018	By-product of drinking water disinfection

MONITORED RAW SOURCE WATER BEFORE IT ENTERS THE TREATMENT PLANT

CONTAMINANT	AVERAGE LEVEL DETECTED (RANGE)	RANGE	UNITS	SAMPLE DATES	POTENTIAL SOURCE(S) OF CONTAMINATION
Bromide	9.05	0 - 79.4	dqq	Jan, Apr, Jul, Oct 2018	Naturally present in the environment
Organic Carbon, Total	1.69	1.31 – 2.17	ppm	Jan, Apr, Jul, Oct 2018	Naturally present in the environment



We encourage customer participation in decisions affecting our drinking water.

- Utilities Board our governing body meets the Wednesday between City Council meetings, 1 p.m. at the Plaza of the Rockies, South Tower, 121 S. Tejon St., fifth floor.
- Call 719-448-4800 or click https://www.csu.org/pages/ub-r.aspx.

GENERAL INFORMATION

- To request a printed copy of this report or for questions, call 719-668-4560.
- For more water quality information or to access past Drinking Water Quality Reports, click https://www.csu.org/pages/water-quality-r.aspx.